



LSM Series

Tension and Compression Sensor Family Manual

Sensor Solutions Source

Load · Torque · Pressure · Multi-Axis · Calibration · Instruments · Software


www.futek.com

Table of Contents


Features	3	Electrical Installation	9
Mechanical Installation	4	Shield Usage and Connections	10
Maximum Installation Torque	5	Calibration	10
Mounting and Installation	6	Troubleshooting	11
Cable Care and Routing	7	Further Support Resources	13




Key Features

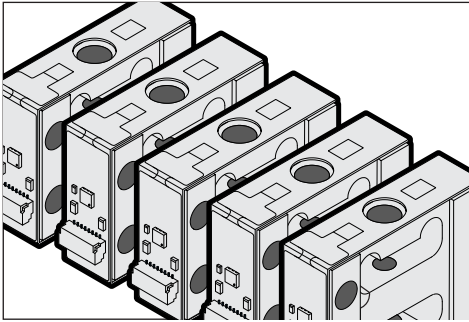


Intended for high volume applications

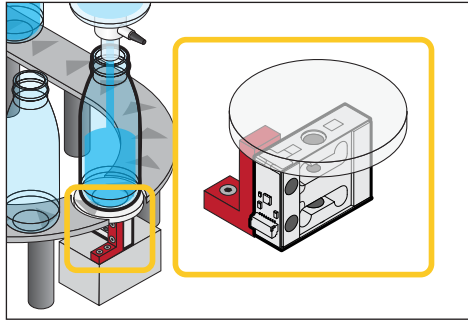

Easily integrates into OEM applications.

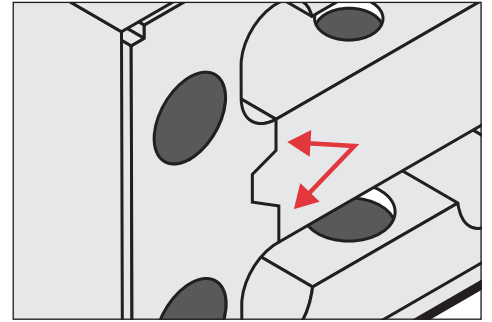

Built-in overload protection

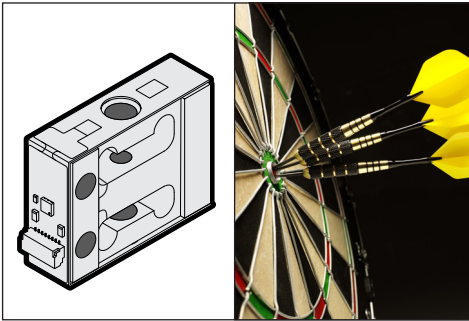

High accuracy.

Mechanical Handling


The following items should be observed to avoid damage to the LSM sensor during installation and usage.

- Avoid conditions that exceed the sensors IP rating.
- Store in a dry area without fixtures.


MAXIMUM MOMENTS AND OFF-AXIS LOADING

- Extraneous load information can be used to assist in determining if the sensor can withstand any unavoidable off-axis loads and moments. Extraneous load information can be found at: <https://www.futek.com/technical-support-extraneous-load-factor>
- An extraneous how-to guide can be found at: <https://www.futek.com/guide-to-calculating-extraneous-loads>


1. Handle exposed components with care. Unit is an OEM component intended for embedded use in system.

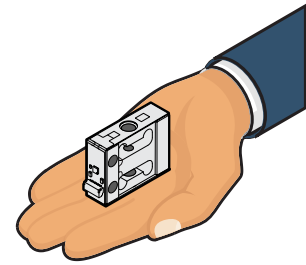


2. Do not pull on or carry sensor by cable.

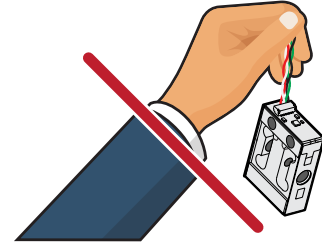


3. Monitor sensor output for effects on zero output during installation to avoid damage.

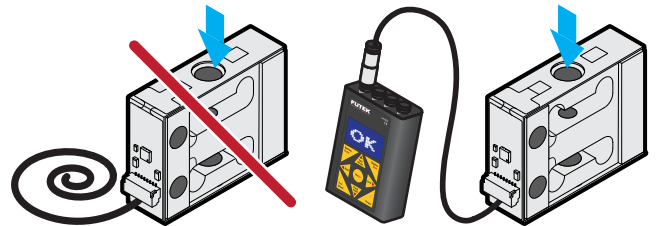


4. Install in a dry, clean environment, unless IP rating allows for other environments

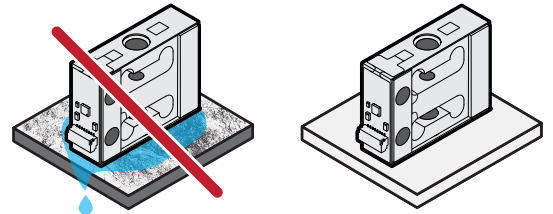

5. Avoid over torque during installation.

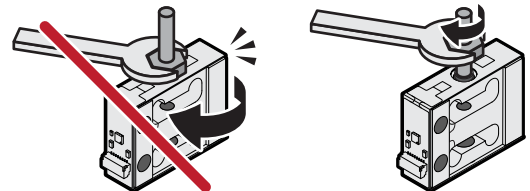

6. Overload protection gap must remain clean and free of debris.

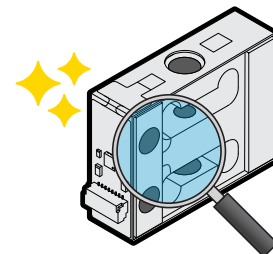



MAXIMUM CENTER HUB INSTALLATION TORQUE (LOADING HOLE)

MODEL	CAPACITY (lbs)	MAXIMUM BOLT TORQUE (in-lbs)
LSM250	0.25	6
	0.5	8
	1	11
LSM300/LSM305	2.2	15
	5	25
	10	35
	25	60
	50	85
	100	125
	200	135

Mounting and Installation


Below is information for proper mounting and installation. Refer to the sensor spec sheet for thread information and proper load cell orientation to maximize performance and limit cable interference.

 Active end

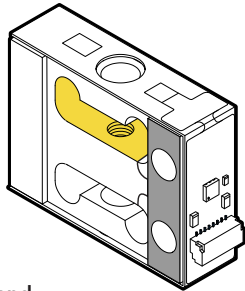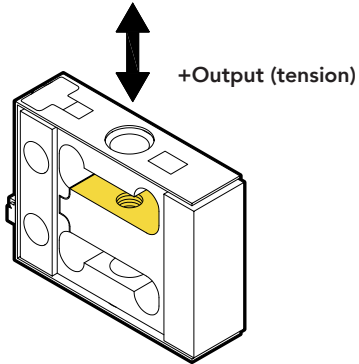


 Fixed end

1. Mount sensor ensuring contact of the entire fixed end with the mating part. Secure sensor to mating part with screws, ensuring proper torque to prevent slippage.

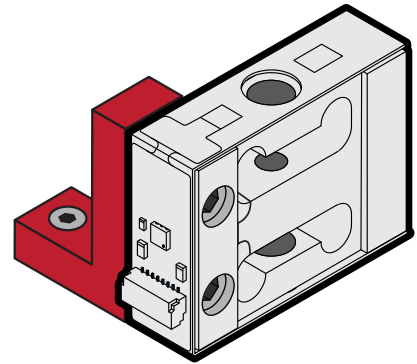


2. Deflecting surfaces must be free from contact or interference. Spacers may be used to help isolate sensor from surfaces.

 Active beam area

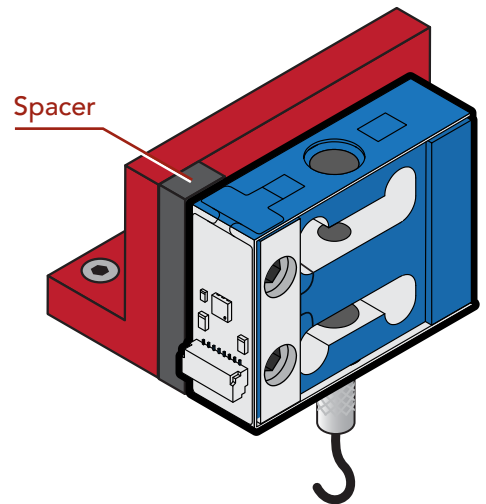


3. Additional Pin holes are available to help with support on the higher capacity 200lb LSM300/LSM305.

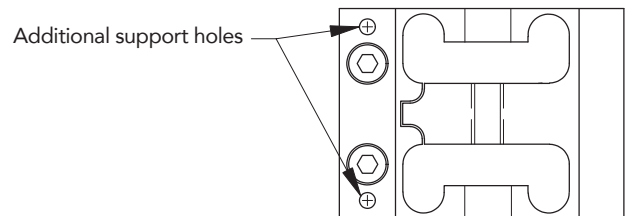


Cable Care and Routing

- Below is information for proper cable care and handling. Cable material type and length can be found online in the sensor description page.


1. Attention and additional handling care are needed for OEM exposed cables and connectors.

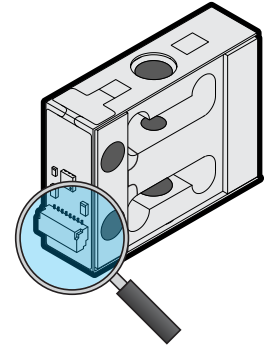

2. Avoid stress and movement on cable to prevent damage.

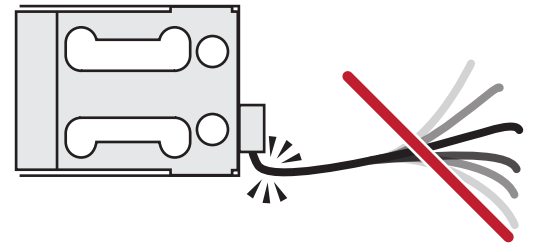


3. Properly secure sensor cable to limit cable movement influence.

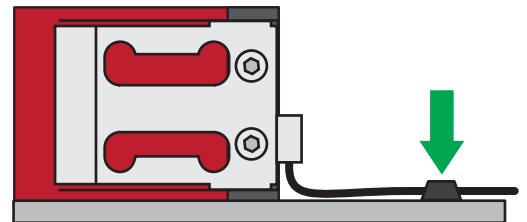

LSM305 Cable Care and Routing


- Below is information for proper cable connection. Cable material type and length can be found online in the sensor description page.

FSH04653
15 cm
8 Position
JST Cable Assembly
 (not included)

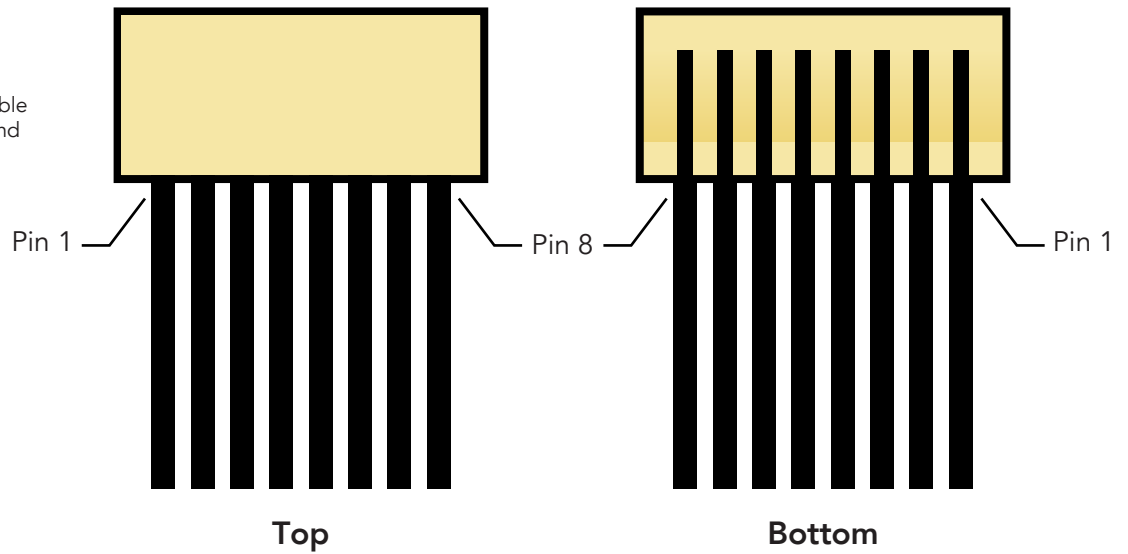

8 POSITION JST CONNECTOR	
P1	+ EXCITATION
P2	- EXCITATION
P3	+ SIGNAL
P4	- SIGNAL
P5	TEDS DATA
P6	RTD LINE 1
P7	TEDS RETURN
P8	RTD LINE 2

COMPATIBLE CABLE ITEM NUMBER: FSH04653 NOT INCLUDED

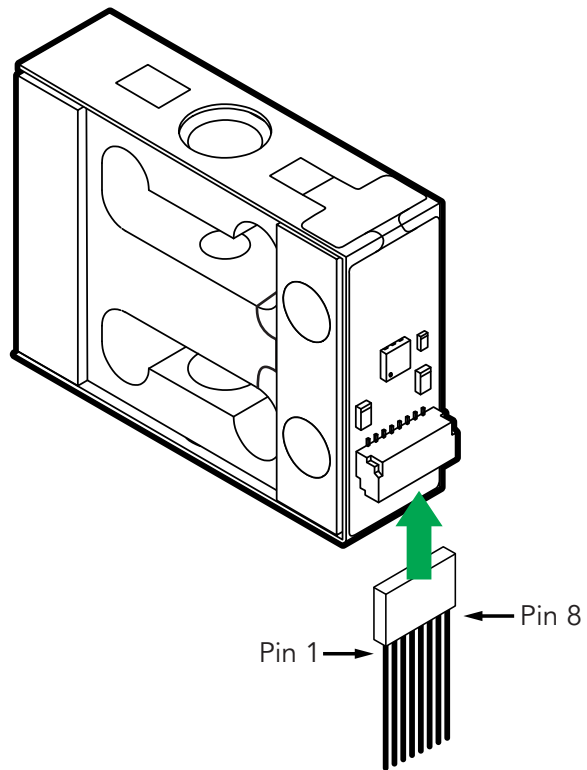


Electrical Installation

WIRING AND CONNECTIONS

- The LSM load cell series utilizes a four-conductor spiral Teflon cable with bare leads.
- Wire connections are + Excitation, – Excitation, + Signal, and – Signal . The coloring code for the LSM series connections are Green, Black, White and Red .
- Consult the sensor’s online spec sheet for any further wiring information

WC2

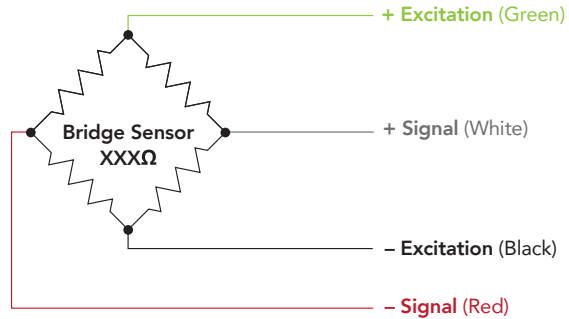

Note: This does not apply to the LSM305.

LSM EXCITATION POWER LEVELS

SENSOR FAMILY	MAX. EXCITATION
LSM250	18 V
LSM300/LSM305	18 V


WIRING CODE (WC2)

GREEN	+ EXCITATION
BLACK	- EXCITATION
WHITE	+ SIGNAL
RED	- SIGNAL

*Color code for this sensor is not FUTEK standard

Shield Usage and Connections

- Cable shielding should be grounded on one end, either the sensor side or instrument side to avoid ground loops.
- A shield connection listed as floating on a sensors spec sheet means the cable shield is not connected on the sensor side and may be connected on the instrument side to ground.

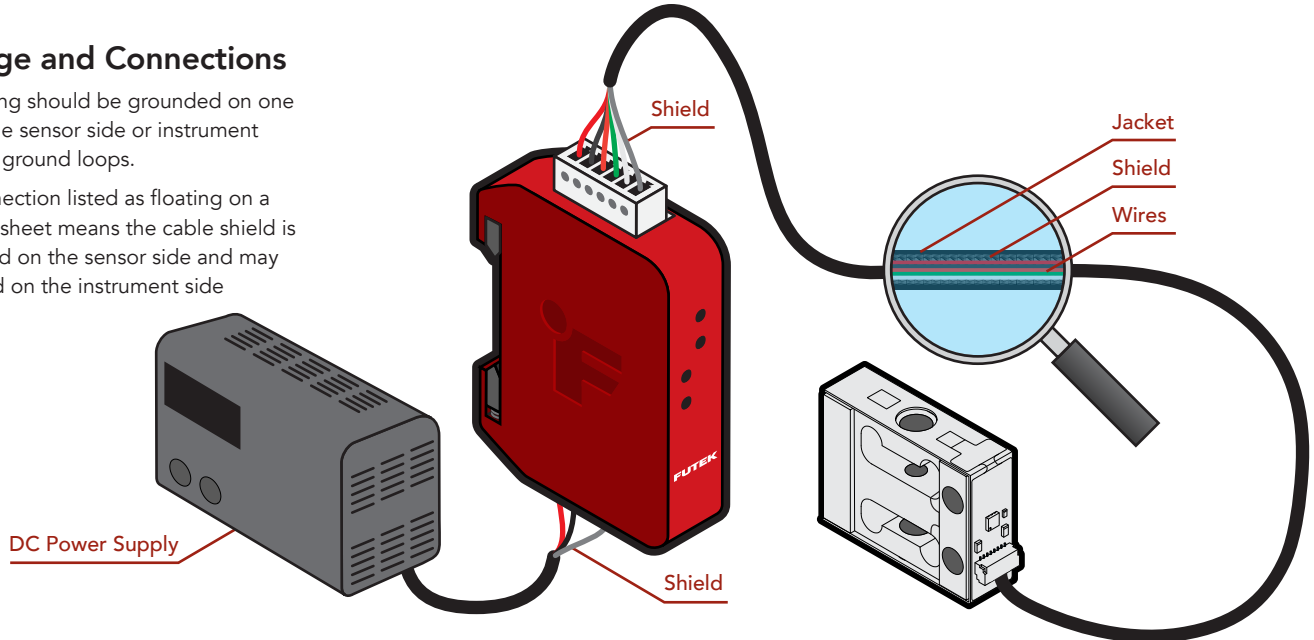

Calibration

- A yearly calibration is recommended. But verification and calibration period shall be defined based on application, conditions, endurance and usage.
- FUTEK offers NIST calibrations as well as A2LA accredited calibrations for total uncertainty.
- For more information on available calibrations visit FUTEK calibration web page at: <https://www.futek.com/store-calibration>
- For recalibration orders visit the FUTEK recalibration page at: <https://www.futek.com/recalibration>
- An online summary of calibration results is available at: <https://www.futek.com/support>

SHUNT

A shunt is an external resistance applied across two points on the load cell's Wheatstone bridge to generate a known, fixed output from the sensor.

Shunt results can be used to set up instruments as well as compare changes to the load cell output over time and usage.

When selecting the appropriate shunt resistance for your load cell, we recommend a resistance that generates an output of about 80% of the sensor's rated output. It is important to have a shunt resistance that results in an output that is less than the full output of the load cell.

An online shunt calculator can be found at <https://www.futek.com/online-calculators> to find a resistance that will generate a certain shunt output level, or to estimate the output for a known shunt resistance.

Additionally, recommended shunt resistance levels may be available on the sensor spec sheet.

TEDS

Transducer Electronic Data Sheet (TEDS) IEEE1451.4 standard is available for FUTEK sensors and is utilized by select FUTEK instruments.

Through the use of TEDS load cell calibration information can be stored with sensor, or sensor cable, for use with TEDS capable instruments.

FUTEK utilizes the Bridge Sensor template 33 for the LSM family.


The following FUTEK instruments are TEDS and LSM compatible:



IPM Series
Panel Mount Display



IHH Series
Handheld Instrument

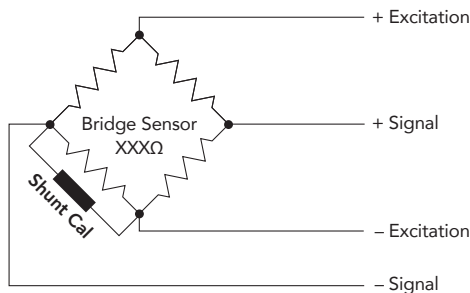

Sensor Solution Source

Load · Torque · Pressure · Multi-Axis · Calibration · Instruments · Software

www.futek.com



U.S. Manufacturer

Troubleshooting

When troubleshooting, we recommend that the sensor be removed from any fixtures. In order to confirm that that sensor is operating correctly, we suggest placing the sensor on a firm surface, and to apply a known load.

We also recommend using a volt meter with a clean power supply to confirm the sensor is operating correctly.

SYMPTOM	POSSIBLE CAUSE	CHECK	REPAIRABILITY
High zero output	<ul style="list-style-type: none"> • Sensor is under preload • Sensor has been overloaded from too much load, off axis load, or moment. • Sensor has experienced high cyclical load fatigue. 	<ul style="list-style-type: none"> • Fixtures or bolting stress for causes of pre-load. • Loading and support placement for off axis loads. • Avoid excessive moments during installation. 	<ul style="list-style-type: none"> • Overload shift would not be repairable. • If zero offset is stable it may be possible to use sensor by use of Tare or subtracting zero from sequential readings.
Non-responsive zero output	<ul style="list-style-type: none"> • Sensor or instrument is not powered. • Sensor is not properly connected. • Load is not displaced properly onto sensor. • Sensor is not supported correctly and not allowing deflection to occur to measure load. • Internal disconnect or short. 	<ul style="list-style-type: none"> • Power and wiring to sensor and instrument. • Sensor bridge resistance for possible opens or shorts. • Perform continuity test on cable. • Load is placed correctly on sensor loading surface. • Sensor loading surface is not obstructed or supported and able to flex under load. • Sensor support is not giving while sensor is loaded. 	<ul style="list-style-type: none"> • Internal disconnections or shorts would not be available for repair. • Sensor cable repair may be available if disconnect or short is not too close to sensor.
Non-responsive high output	<ul style="list-style-type: none"> • Sensor is disconnected from instrument. • An opening has occurred in sensor or cable connection. • Sensor has been overloaded and deformed causing permanent high stress on internal gauges. • Fixture, applied load, or mounting is causing a high pre-load on sensor. 	<ul style="list-style-type: none"> • Power and wiring to sensor and instrument. • Sensor bridge resistance for possible opens or shorts. • Perform continuity check on cable. • Sensor zero output to see if sensor returns to zero or has a high zero load output due to overloading. • Remove load and loosen mounting bolts or fixtures to check if sensor is being preloaded. 	<ul style="list-style-type: none"> • Overload shift would not be repairable. • Internal disconnections or shorts would not be available for repair. • Sensor cable repair may be available if disconnect or short is not too close to sensor.
Incorrect output for applied load	<ul style="list-style-type: none"> • Load is not applied correctly to sensor loading surface or is off axis. • Fixtures are not secure or obstruct loading. • Sensor loading surface is not able to deflect with applied load. • Sensor support is not ridged and firm. • Incorrect sensor output is utilized. 	<ul style="list-style-type: none"> • Placement of load on sensor. • Fixtures are not impeding ability to load. • Support surface is not giving with applied load. • Calibration verified outputs are being used. 	<ul style="list-style-type: none"> • Recalibration is available for confirmation of sensor performance.

SYMPTOM	POSSIBLE CAUSE	CHECK	REPAIRABILITY
Zero output drift	<ul style="list-style-type: none"> • Unstable power supply, or noisy power supply, to sensor. • Sensor exposed to temperature change. • Sensor exposed to pre-load from fixture or mounting. • Sensor exposed to liquid or humidity. 	<ul style="list-style-type: none"> • Stability of power supply and noise levels. • For temperature changes or unevenly distributed temperature changes. • Possible loose fixtures and bolts 	<ul style="list-style-type: none"> • Internal damage from liquid exposure is not repairable. • Recalibration is available for confirmation of sensor performance.
Creep in output while under load	<ul style="list-style-type: none"> • Load or fixtures are not stable. • Power supply is unstable or noisy. • Sensor is exposed to temperature change. • Sensor support is not rigid and firm. • Sensor exposed to liquid or humidity. • Friction in assembly 	<ul style="list-style-type: none"> • Stability of power supply and noise levels. • Fixtures for stability. • For temperature changes or unevenly distributed temperature changes. • Confirm support surfaces are not giving while under load. 	<ul style="list-style-type: none"> • Internal damage from liquid exposure is not repairable. • Recalibration is available for confirmation of sensor performance.
Noisy or unstable output	<ul style="list-style-type: none"> • Power supply is noisy. • Load is not stable. • Sensor or cable is placed close to high power equipment. • Sensor or instrument is exposed to ground loop with other equipment grounds. 	<ul style="list-style-type: none"> • Power supply stability. • Load is stable and fixtures are secure. • Reroute cables away from high power equipment. • Confirm wiring and grounds are not connected to unintended equipment ground. 	<ul style="list-style-type: none"> • There are no active electronics in a load cell, such as capacitors or IC chips that may contribute to noise.

Further Support Resources

- Tips on noise reduction can be found at:
<https://www.futek.com/white-papers-how-to-reduce-electrical-noise-in-your-system>
- Support information for FUTEK instruments can be found online at: <https://www.futek.com/instrument-manuals>
- A one year recalibration is recommended. But verification and calibration period shall be defined based on application, conditions, endurance and usage. Calibration data may be available online at <https://www.futek.com/support>
- To send in your sensor or system for recalibration visit our FUTEK calibration web page at: <https://www.futek.com/recalibration>
- FUTEK Technical Support may be reached at: <https://www.futek.com/contact/technical-request>
- To send in your sensor or system for evaluation and repair visit our FUTEK RMA web page at: <https://www.futek.com/rma>
- FUTEK contact information can be found online at: <https://www.futek.com/about/contact>
- Warranty information can be found online at: <https://www.futek.com/support>

Drawing Number: EM1053-A